


PFV-106-R

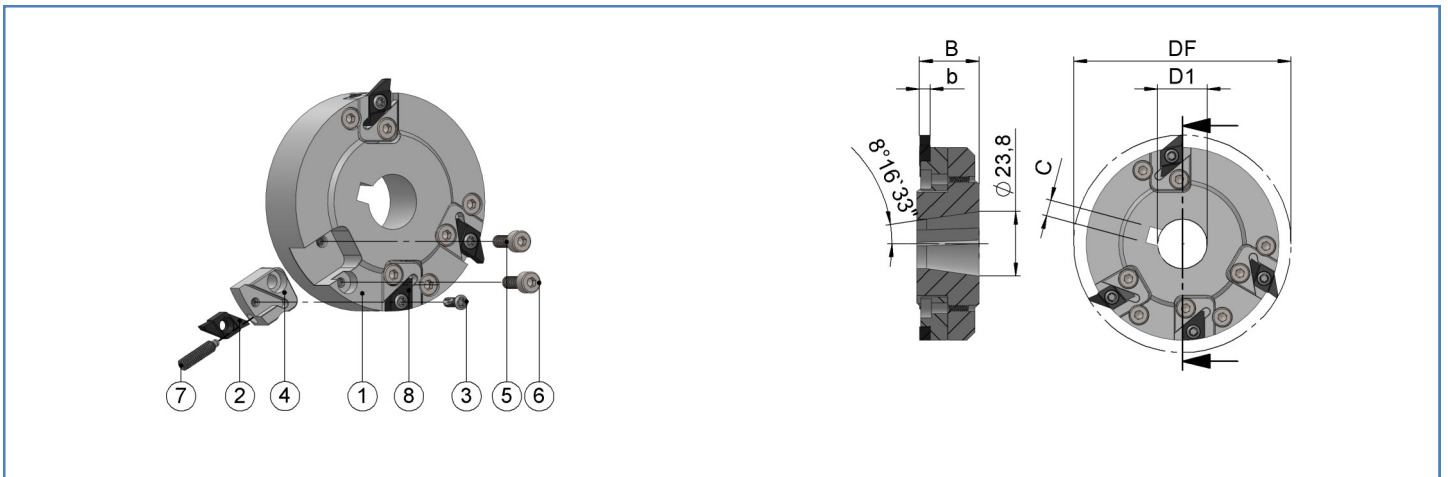

Grundhalter - Aufnahme Typ 7: Konisch mit Keilnut parallel zum Konus

Base holder - type 7: Conical with keyway parallel to cone / Support de base - type 7: Conique avec clavette parallèle au cône

| Art. Nr. Item no. Réf. | Bezeichnung Designation Désignation | Maschinentyp Machine type Type de machine | DF | D1 | Konus Cone Cône | B | C | A | Drehrichtung Direction of rotation Sense de rotation | (2) Platte Insert Plaquette |
|------------------------------|---|---|----|------|-----------------------|----|---|---|--|---|
| 112132 | PFV-106-R | Gildemeister GS22/ GM20/35-8/ C35 | 86 | 23,8 | 8°16'33" | 23 | 6 | - | R | SMP-08-400.. b = 4 t _{max} = 4 |

Ersatzteile

Spare Parts / Pièces de rechange

| (3) Schraube Screw Vis | | (4) Kassette Cartridge Cassette | | (5) Schraube 1 Screw 1 Vis 1 | | (6) Schraube 2 Screw 2 Vis 2 | | (7) Stellschraube Adjusting screw Vis de réglage | | (8) Auswuchtteil Balancing insert Plaqu. de balance | |
|------------------------------|----------------------|---------------------------------------|-----------------------------|------------------------------------|---------------------------|------------------------------------|-----------------------|--|-------------------------------|---|---------------------------|
| Art. Nr. Item no. Réf. | Bez. Des. Dés. | Art. Nr. Item no. Réf. | Bez. Des. Dés. | Art. Nr. Item no. Réf. | Bez. Des. Dés. | Art. Nr. Item no. Réf. | Bez. Des. Dés. | Art. Nr. Item no. Réf. | Bez. Des. Dés. | Art. Nr. Item no. Réf. | Bez. Des. Dés. |
| 107349 | M3x8 | 108845 | PFV-08-19-R | 109072 | PFV-M6x16 | 108854 | M4x16 | 108850 | PFV-M4x0,5x16 | 103383 | SMAT-08-N |
| 103594 | T10 | | | 108856 | SW-5 | 103200 | SW-3 | 107245 | SW-2 | | |

